
The pollution reality of gold mining waste on the Witwatersrand

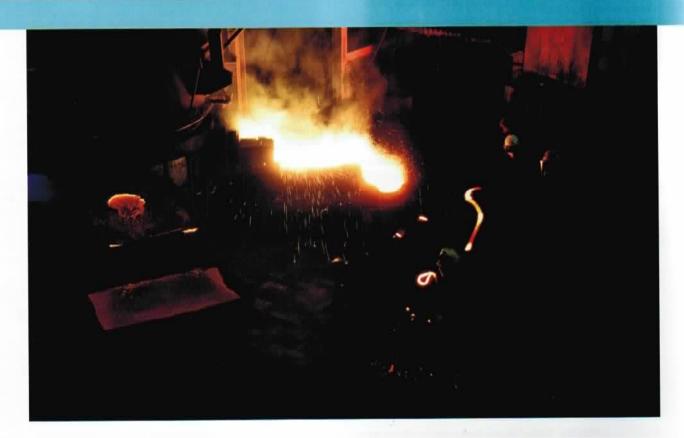

Waste from gold mines constitutes the largest single source of waste pollution in South Africa and there is wide acceptance that acid mine drainage (AMD) is responsible for the most costly environmental and socio-economic impacts. SHH Oelofse, PJ Hobbs, J Rascher and JE Cobbing of the CSIR, Natural Resources and the Environment, conducted this case study.

Thile South Africa has made significant progress in shifting policy frameworks to address mine closure and minewater management, and the mining industry has changed their practices to conform to new regulations, vulnerabilities in the current system still remain. The pollution reality of gold mining waste is illustrated by a case study in the West Rand area, where decant from gold mines started in 2002. Potential receptors of the pollution in the case study area include neighbouring property own-

ers, a game reserve and, further afield, the Cradle of Humankind World Heritage Site. The case study illustrates many of the technical, socio-economic and governance challenges faced by industry and regulators in managing the negative impacts derived from mine waste.

Introduction

By 1997, South Africa produced an estimated 468 million tonnes of mineral waste per year. Gold mining waste was estimated to account for 221 million tonnes or 47% of all mineral waste produced in South Africa, making it the largest, single source of waste and pollution. There are more than 270 tailings dams in the Witwatersrand Basin, covering approximately 400 km² in surface area. These dams are mostly unlined and many are not vegetated, providing a source of extensive dust, as well as soil and water (surface and groundwater) pollution.

Historically, impoundment on land was the preferred option for tailings disposal on the Witwatersrand (figure 1). The environmental implications of this disposal option include contamination of streams by AMD, contamination of streams due to surface run-off

Parameter	Spring water		Borehole water		Natural groundwater	SANS 241 Class I
	3.9	×	6.1	1	7.2	5.0 - 9.5
Electrical conductivity (mS/m)	265	×	111	1	17	< 150
Calcium (mg// Ca)	262	×	101	1	16	< 150
Magnesium (mg/ / Mg)	133	×	57	1	10	< 70
Sodium (mg// Na)	111	1	60	1	4	< 200
Potassium (mg/ / K)	7.8	1	3.6	1	0.5	< 50
Chloride (mg// CI)	98	1	70	1	2.5	< 200
Sulphate (mg// SO ₄	1516	×	447	×	22	< 400
Total alkalinity (mg// CaCO ₃)	2.5	1	16	1	56	unspecified
Nitrate (mg// N)	4.1	1	6.5	1	1.6	< 10
Fluoride (mg// F)	0.1	1	0.1	1	0.1	< 1.0
Iron (mg/l Fe)	0.103	1	0.012	1	0.031	< 0.2
Manganese (mg/ / Mn)	100	×	0.035	1	0.012	< 0.1
Zinc (mg/ℓ)	0.433	1	0.012	1	0.012	< 5.0

× Denotes non-compliance with SANS 241:2005 Class I recommended operational limit

from the impoundment area, air and water contamination due to wind erosion of driedout tailings, possible risk of catastrophic dam failure and release of slimes, physical and aesthetic modification to the environment, and difficulty of establishing vegetative cover to permanently stabilise the tailings, owing to unfavourable soil conditions in the presence of pyritic tailings.

Many of the tailings dams in the Johannesburg area remained undisturbed for nearly a century during which time they have been exposed to oxygenated rainwater. This has resulted in oxidation of the pyrite and other sulphides in the material, particularly an outer layer of the dumps several meters thick. The sand dumps are generally more permeable, older and more seriously affected by the oxidation. According to Marsden (1986), the oxidation has typically reached a depth of about 5 m in the sand dumps and about 2 m in the slimes dumps.


Acid mine drainage


The types of mine waste problems are numerous, but the most difficult one to address is the AMD that emanates from both surface and underground workings, waste and development rock, and tailings piles and ponds. Surface impacts are mostly from tailings and rock dumps and adversely affect both groundwater and surface water quality. Underground impacts are generally characterised by the inflow of water into the underground workings and the subsequent dewatering of the aquifer.

Elaborate pumping systems employed in the beginning of the 20th century to increase profits, resulted in the modification of the water table, appearance of sinkholes, and elevated levels of water, air, and soil pollution. The rebound of water levels after mine closure can lead to contaminated groundwater being discharged. The primary management issues for underground gold mine closure therefore include long term decant risk, acid mine drainage,

water pumping and treatment and allocation of responsibility especially in view of the interconnectedness of the mines.

AMD probably presents the single most important factor in dealing with tailings and waste rock and their impact on the environment. Due to the more disaggregated (and more concentrated, in the case of tailings) nature of the acid-generating minerals in the waste materials, AMD that flows from them may be more aggressive than that which discharges from the mine itself. Another consideration here is the potential long-term pollution problem, as production of AMD may continue for many years after mines are closed and tailings dams decommissioned. AMD is produced when sulphide-bearing material is exposed to oxygen and water. The production of AMD usually, but not exclusively, occurs in iron sulphide-aggregated rocks. Although this process occurs naturally, mining promotes AMD formation simply by increasing the quantity of sulphides exposed. Releases of

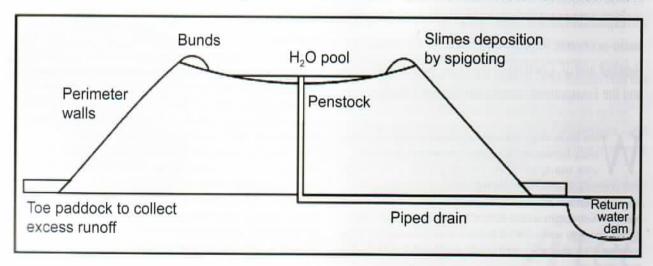

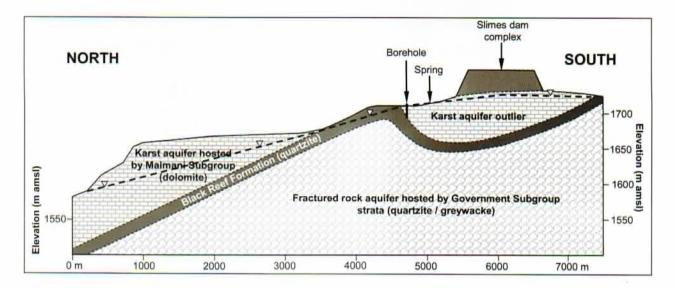

AMD have low pH, high electrical conductivity, elevated concentrations of iron, aluminium and manganese and raised concentrations of toxic heavy metals. The acid produced dissolves salts and mobilises heavy metals from mine workings. Dark, reddish-brown water and pH values as low as 2.5 persist at the site. AMD is not only associated with surface and groundwater pollution, but is also responsible for the degradation of soil quality, for harming aquatic sediments and fauna, and for allowing heavy metals to seep into the environment.

AMD follows the same flow pathways as water and can therefore be best controlled by:

- controlling water entry into the site of acid formation by diversion of surface water away from the residue storage areas
- prevention of groundwater infiltration into the mine workings
- · prevention of hydrological seepage into the affected areas, and
- · controlled placement of acid-generating waste.

Diversions most commonly consist of ditches, which are difficult to maintain for long periods of time. Groundwater discharge areas should be avoided as isolation and interception of contaminated groundwater is very difficult to achieve. Under-drains can be installed in locations of the dumps, and the infiltration by meteoric water can be further retarded through the use of sealing layers.

The West Rand case study

In April 2005, the media drew attention to the West Rand basin with news headlines such as "A rising acid tide" and "Acid river rocks Cradle of Humankind". The reports went on to state that "South Africa's renowned Cradle of Humankind in Gauteng, home to one of the world's richest hominid fossil sites, is under threat from highly acidic water pollution..." (Independent online, 14 April 2005) and "It is also threatening to drown the Sterkfontein caves." (Mall & Guardian, 12 April 2005). The Mail & Guardian continues to accuse scientists, mining companies and government of reluctance to discuss the mine water decant and its impact publicly "... and yet it is the start of a problem of such magnitude that it will affect our environment and health for decades to come" (Mail & Guardian, 12 April 2005). While undeniably sensationalist, these reports highlight important issues that inform the government-society-science trialogue.

A slimes dam complex located north of Randfontein on the West Rand, Gauteng, South Africa occupies a footprint of some 300 ha, is about 50 m high and situated on the continental water divide.


The dam is predominantly bare of vegetation, and dust suppression by means of water spraying is an ongoing management activity. Dust suppression has the additional benefit of facilitating the disposal of considerable volumes of AMD presently decanting from a nearby shaft.

The slimes dam, together with others in the wider area, is the legacy of many decades of underground gold mining and, more recently, opencast mining in the region. The hydro-geological cross-section (figure 2) reveals the receiving subsurface environment underlying and down gradient of the facility. The positioning on top of a karst aquifer reflects the weighting afforded economic as opposed to environmental factors that historically governed the placement of mine residue sites. Groundwater drainage from the dolomitic strata is dominated by a spring discharging in a westerly direction at an estimated 25 ℓ /s in March 2007. The spring rises some 380 m to the north-northwest of the toe of the slimes dam. A subordinate groundwater flow vector is manifested toward the north, mainly as a result of abstraction from a borehole located about 590 m from the toe of the facility on a neighbouring property.

The water-quality analyses presented in table 1 reflect the hydrochemistry of the spring and borehole water, and compare these to that of natural dolomitic groundwater in the wider region. The SANS 241 recommended operational limits for a Class I drinking water provide a further basis for comparison.

The spring water reflects a clearly compromised drinking water quality regarding six (marked × in Table 1) of the listed parameters, most notably pH, sulphate and manganese. Viewed in isolation, the borehole water only reveals marginal non-compliance with the SANS 241 standard in regard to one parameter (sulphate). A comparison with the natural ambient dolomitic groundwater, however, reveals the measure of overall water quality degradation manifested in both the borehole and the spring water. The similarities (and differences) in water quality are more clearly illustrated in figure 3.

Under circumstances where the spring water drains via a shallow open ditch across private property toward the west, concern must exist for the exposure of humans and animals along the flow path to the contaminated water. The ditch passes through at least one small farm dam that is used for recreational purposes. An ICP scan revealed elevated levels of numerous trace metals such as aluminium, cadmium, cobalt and nickel in the spring water. The

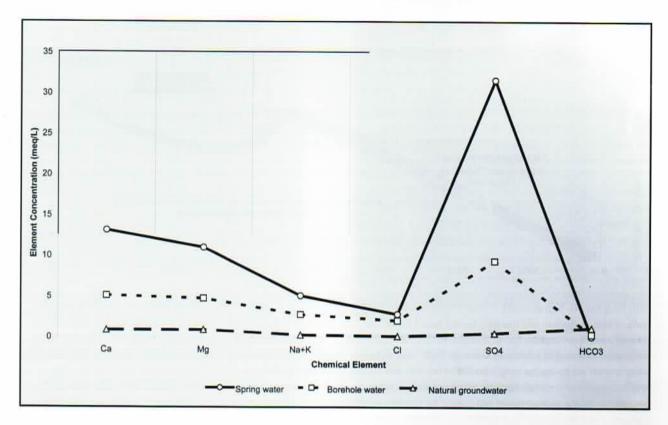

water eventually reports to a surface water drainage, where its impact is subsumed under the effluent discharge from a municipal waste-water treatment works located upstream of the confluence.

Although more work needs to be done to establish beyond a doubt whether the slimes dam is responsible for the ground-water pollution, at the very least the results suggest that, following the precautionary principle, further investigations need to be conducted with some urgency. If the slimes dam is indeed responsible, it will need to be established whether the pollution arises from the rainwater percolating through the slimes dam, or from the water used in dust suppression, or a combination of both.

To the northeast of the slimes dam complex, acid mine drainage from defunct and flooded underground mine workings first reported to surface via a borehole in August 2002. Decant has subsequently been manifested at various mine shafts and diffuse surface seeps in the area. Up until the completion in early 2005, of storage and pumping facilities to contain and manage some 15 M l/d of decant on average, the AMD reported to an adjoining natural water course and flowed northward through a game reserve, further downstream of which lies the Cradle of Humankind world heritage site. Aquatic biomonitoring programmes carried out in 2000 and in 2004, i.e. before and after decant

commenced, revealed a drastic drop in macro-invertebrates in the water course. The impact of AMD on the drinking water supply of game in the game reserve has also been blamed for various phenomena. These include a significant decrease in the populations of blesbuck, springbuck and lion, and diseases such as liver necrosis and testicular degeneration among game.

Socio-economic impacts of AMD

Access to clean water is universally accepted to be a precondition for economic and social development. It is also an essential resource for drinking, household use and food production. Pressure from a growing AMD pollution load in the West Rand area, is putting this invaluable resource under threat. It is therefore not surprising that the decanting of AMD near Krugersdorp is accompanied by several socio-economic consequences, of which human and animal health risk is of the greatest concern. Residents in the decant area that rely on borehole water, raised concerns about the orange colour of the water, which is a result of sulphur compounds present in AMD.

Long-term exposure to AMD-polluted drinking water may lead to increased rates of cancer, decreased cognitive function and appearance of skin lesions. Studies on the exposure of pregnant woman to relatively low concentrations of heavy metals and other industrial chemicals in drinking water revealed that the neural development of the foetus could be compromised, which can result in mental retardation. Recent studies conducted by the South African Council for Geosciences (CGS), concluded that AMD in some of the areas contains high levels of radioactivity which may increase the risk for cancer.

Soil pollution may, apart from contaminating food produced in the area, also affect the health of specific cultural groups through the phenomenon of geophagy (the practice of eating earth) that is common in sub-Saharan Africa. It is believed that the mineral content in clays contain high levels of calcium, iron, copper and magnesium that are essential minerals for the human diet, but even more critical during pregnancy.

As a result of polluted mine-water spilling out into the environment and the strong sentiments about the relationship between the mining industry and government, AMD has become a very visible and highly political issue in South Africa. Mine closure and the associated increase in AMD also have serious consequences for communities previously supported by the mining sector. Mine closure results in loss of job opportunities and increased unemployment. In addition, informal settlements with associated social pathologies are on the increase. Subsistence farming is often the

last resort for such communities, but AMD may render the available water resources unfit for agricultural use.

Governance

A review of local literature and legislation by Godfrey et al. (2007) has shown that much confusion exists in South Africa regarding the roles and responsibilities of the Department of Minerals and Energy (DME) and the Department of Water and Environmental Affairs (previously the Department of Environmental Affairs and Tourism (DEAT)), with respect to the management of mining waste. Both departments have placed certain requirements on mines before a closure certificate could be granted. The main requirement is an environmental management plan (EMP), which is compulsory for any mine and for which DME is the lead agent. Cooperative governance is, however, not very effective in protecting the environment against the negative impacts of mining waste.

Closure planning as embodied in EMP reports of gold mines in South Africa is currently inadequate to protect the water resources impacted by mining activities. The status at the end of 2001 of approximately 40 gold mine closure plans, as described in their EMP reports, are summarised by Banister et al. (2002). The pertinent misconceptions and shortcomings include that most mines recognise that tailings dams generate AMD. However, it is generally and incorrectly assumed that the impact will decrease to acceptable levels when the mining operations cease. It appears to be quite widely assumed that the larger particle size of waste rock dumps makes them a lesser pollution risk. This view is erroneous, as the waste rock dumps have very large inventories of fine material and are much more permeable to oxygen than tailings dams. It is also not clear if the extent of contamination plumes is known.

Conclusions

If indeed the extent of "... problems related to mining waste may be rated as second only to global warming and stratospheric ozone depletion in terms of ecological risk" then the Witwatersrand gold mining area is at serious risk. Being the economic heartland of South Africa, few natural ecosystems remain and, as indicated by the case study, the impacts of mining and other problems related

with mine closure and mine-water management that cannot easily be addressed over the short term, may have devastating consequences for more than just ecosystems. It will be a sad day if AMD is allowed to impact negatively on archaeological material preserved over millennia, leaving questions of human origin unanswered.

The end of mining in the region is sadly not the end of impacts from mining and the mine waste dumps. Long-term closure and post-closure management measures will determine the ultimate fate of an environment which includes sites of international importance such as the Cradle of Humankind. 35

References:

AngloGold Ashanti, 2004

DWAF, 2001:

Pulles et al. 2005

Wiley and Katz, 1998

EEB. 2000

Bannister et al., 2002

Du Toit, 2006

Adler and Rascher, 2007

Warhurst and Noronha, 2000

Grandjean and Murata, 2007: Grandjean and Landrigan, 2006.

Bellinger et al., 1987

Hobbs and Cobbing, 2007

SABS. 2005

Adler and Rascher, 2007; Ashan, 2004; Bellinger et al., 1992

Coetzee et al., 2005, 2006

Hobbs and Cobbing, 2007

Molden and Merrey, 2002; Gilbert et al.; 1997

Turton et al., 2007

Akcil and Koldas, 2006

Johnson and Hallberg, 2005

Adler and Rascher, 2007; Adler et al., 2007; IIED, 2002

Ritcey, 2005

Durkin and Herrmann, 1994

Banister et al., 2002

Wilson et al., 1998

RéSource May 2010 - 55

LANDFILL COMPACTORS (FOR SALE)



from R395,000 - R995,000

Machines available in stock ex Durban (23 – 30 tons)

Regular imports of **HANOMAG, BOMAG & CAT** (23 – 45 tons)

Machines repaired & serviced at our workshop

Hanomag parts agent

PTN PARTS & EQUIPMENT CC

CONTACT STEVE 031 700 3907 CELL 083 226 6156